

Work Order ID 47306

June 26, 2009 12:15:05 PM



Page 1

Item ID: D3391-021

Revision ID: H

Item Name: Fwd Tube Assembly

Start Date: 15/07/2009 Start Qty: 1.00

Required Date: 03/08/2009 Req'd Qty: 1.00

Reference:

Accept



Setup Start



Stop



Cust Item ID:

Customer:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start



QC:

Date:

SPC (Y/N):

Date:

Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Draw Number	Draw Rev.	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	----------------	--------------	--------------	---------------	---------------	------------------	----------------

Draw Nbr

Revision Nbr

D3391

Rev H

100

0.00



Skidtubes

Skidtubes

Memo

0.00

Skidtubes

Cut extrusion to 46.52 +0.010 -0.020



110

0.00



BENDING MACHINE - SKIDTUBES

CNC Bend 1

Memo

0.00

CNC Delta 100 Bender

Bend as per Dwg D3391 Using Bend Prog 3391021



120

0.00



QC5- Inspect part completeness to step on W/O

QC

Memo

0.00

Quality Control

frustrating

Work Order ID 47306

June 26, 2009 12:15:05 PM



Page 2

Item ID: D3391-021
Revision ID: H
Item Name: Fwd Tube Assembly

Accept



Setup Start



Stop



Start Date: 15/07/2009 Start Qty: 1.00



Required Date: 03/08/2009 Req'd Qty: 1.00



Cust Item ID:

Customer:

Reference:

Approvals: Process Plan:

Date:

Tooling:

Date:

Run Start



QC:

Date:

SPC (Y/N):

Date:

Stop



Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Draw
Number

Draw
Rev.

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

130

0.00



HAAS CNC VERTICAL MACHINING #1

HAAS 1

Memo

0.00

HAAS CNC vertical machine #1

1-Machine as per Folio FA590 Rev. ____ & Dwg D3391 Rev. ____ Identify as
D3391-1112-Deburr



140

0.00



QC2- Inspect parts off machine FAI/FAIB

QC

Memo

0.00

Quality Control



150

0.00



CONVENTIONAL MILLING MACHINE

Mill Conv

Memo

0.00

Conventional Milling Machine

Drill X1 Aft cap as per Dwg D3391 .1875" dia



Work Order ID 47306

June 26, 2009 12:15:05 PM



Page 3

Item ID: D3391-021
Revision ID: H
Item Name: Fwd Tube Assembly

Accept



Setup Start



Stop



Start Date: 15/07/2009 Start Qty: 1.00



Required Date: 03/08/2009 Req'd Qty: 1.00



Cust Item ID:

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start



QC:

Date:

SPC (Y/N):

Date:

Stop



Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Draw
Number

Draw
Rev.

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

160

QC2- Inspect parts off machine FAI/FAIB

0.00

QC

Memo

0.00

Quality Control

170

QC8- Inspect parts - second check

0.00

QC

Memo

0.00

Quality Control

180

Skidtubes

0.00

Skidtubes

Memo

0.00

Skidtubes

1-Drill float bag holes as per Dwg D3391 using DT8798(Do not open tow cap holes to finish size) (ONLY DRILL HOLES MARKED "A"). 2-Drill Remaining two holes for tow cap using DT 8819 Locating off of .1875" holes drilled in previous step 3-Open tow cap hole

Work Order ID 47306

June 26, 2009 12:15:05 PM



Page 4

Item ID: D3391-021

Revision ID: H

Item Name: Fwd Tube Assembly

Start Date: 15/07/2009 Start Qty: 1.00

Required Date: 03/08/2009 Req'd Qty: 1.00

Reference:

Accept



Setup Start



Stop



Cust Item ID:

Customer:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start



QC:

Date:

SPC (Y/N):

Date:

Stop



Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Draw
Number

Draw
Rev.

Plan
Code

Accept
Qty

Reject
Qty

Reject
Number

Insp.
Stamp

190



QC

Quality Control

QC5- Inspect part completeness to step on W/O

0.00

Memo

0.00



200



HandFinish

Hand Finishing

Chemical Conversion Coat per QSI005 4.1

0.00

Memo

0.00



210



QC

Quality Control

QC3- Inspect Part Finish

0.00

Memo

0.00



Work Order ID 47306

June 26, 2009 12:15:05 PM



Page 5

Item ID: D3391-021
Revision ID: H
Item Name: Fwd Tube Assembly

Accept



Setup Start



Stop



Start Date: 15/07/2009 Start Qty: 1.00
Required Date: 03/08/2009 Req'd Qty: 1.00



Cust Item ID:
Customer:

Reference:

Approvals: Process Plan:
QC:

Date:
Date:

Tooling:
SPC (Y/N):

Date:
Date:

Run Start
Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Draw Number	Draw Rev.	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
220 	Skidtubes	0.00							
Skidtubes	Memo	0.00							
Skidtubes	1-instal spacers as per dwg D3391-A/R Magnabond 6398 batch: exp. date: cure time 12hrs. as per QSI015: 12- grind crossbolt flush 13-back drill crossbolt if necessary								
230 	QC5- Inspect part completeness to step on W/O	0.00							
QC	Memo	0.00							
Quality Control									
240 	White Gloss(Ref:4.3.5.1) per QSI005 4.3-Alum	0.00							
Powdercoat	Memo	0.00							
Powder Coating	START TIME: OVEN TEMPERATURE: FINISH TIME:								

Work Order ID 47306

June 26, 2009 12:15:05 PM



Page 6

Item ID: D3391-021
Revision ID: H
Item Name: Fwd Tube Assembly

Accept



Setup Start



Stop



Start Date: 15/07/2009 Start Qty: 1.00
Required Date: 03/08/2009 Req'd Qty: 1.00



Cust Item ID:
Customer:

Reference:

Approvals: Process Plan: Date: Tooling: Date:
QC: Date: SPC (Y/N): Date:

Run Start
Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Draw Number	Draw Rev.	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
250 QC Quality Control	QC3- Inspect Part Finish Memo	0.00 0.00							
260 Packaging Packaging	Identify as per dwg & Stock Location: _____ Memo	0.00 0.00							
270 Skidtubes Skidtubes	Skidtubes Memo **** install D3591-1 spacer as per DSI9364 ****	0.00 0.00							

w/o 47883
pulled
D412-742-043
mf 09-07-16

Work Order ID 47306

June 26, 2009 12:15:05 PM



Page 7

Item ID: D3391-021
Revision ID: H
Item Name: Fwd Tube Assembly

Accept



Setup Start



Stop



Start Date: 15/07/2009 Start Qty: 1.00



Required Date: 03/08/2009 Req'd Qty: 1.00

Cust Item ID:

Customer:

Reference:

Approvals: Process Plan:

Date:

Tooling:

Date:

Run Start



QC:

Date:

SPC (Y/N):

Date:

Stop



Sequence ID/
Work Center ID

Operation
Description

Set Up/
Run Hours

Draw Number	Draw Rev.	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
----------------	--------------	--------------	---------------	---------------	------------------	----------------

280

QC21- Final Inspection - Work Order Release

0.00



QC

Memo

0.00

Quality Control

09/07/14
MF 09-07-15

June 26, 2009 12:15:05 PM

Parent Item: D3391-021RevH

Parent Item Name: Fwd Tube Assembly

Comments:

Start Date: 15/07/2009

Required Date: 03/08/2009

Start Qty: 1.00

Required Qty: 1.00

[illegible]

Picklist Print

June 26, 2009 12:15:05 PM

Page 2

Work Order ID: 47306

Parent Item: D3391-021RevH

Parent Item Name: Fwd Tube Assembly



Comments:

Start Date: 15/07/2009

Required Date: 03/08/2009

Start Qty: 1.00

Required Qty: 1.00

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Remaining Qty To Pick	Qty Issued	Date Issued	Status
✓ D3672-1RevB ✱  Phenolic Washer		Manufactured	No		B42329	260	Each	0.0000	4.0000			
						umd	09/07/06					

June 26, 2009 12:15:05 PM

Shop Packet Print

Page 2

Date: Monday, 20/04/2009 1:54:33 PM
 User: Julie Dawson

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services	Drawing Name : FWD TUBE ASSEMBLY
Job Number : 47306	
Estimate Number : 10467	
P.O. Number :	Part Number : D3391021
This Issue : 20/04/2009 S.O. No. :	Drawing Number : D3391 REV H
Prsht Rev. : NC	Project Number : N/A
First Issue : / / Type : SKIDTUBES	Drawing Revision : H
Previous Run : 47305	Material :
Written By :	Due Date : 05/05/2009 Qty: 1 Um: Each
Checked & Approved By : <u>JUD 09-04-20</u>	
Comment :	

Est. A 05.09.13 New issue KJ/JLM
 Est. B 06.02.10 Dwg rev.D ecn 773 EC
 Est. C 06.05.02 Added inspections EC
 est D 07.03.13 rev F dwg EC
 est E 07.11.07 revG dwg ecn1053P EC verified by: DD
 Est Rev:f ECN 1056 07-11-12 DD verified by: EC
 Est Rev:G 08-09-08 new process (ecn 08-510) DD verified by:EC
 Est Rev:H 08-09-10 revH as per dwg DD verified by:EC
 Est Rev J 09.02.02 added hardware EC verified by: DD

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
----------------	------------------------------	----------------------

1.0	D6013047	Skidtube Material
-----	----------	-------------------



Comment: Qty: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

SKIDTUBE MAT'L

Pick:

Qty	Part Number	Description
1	D6013-047	Extrusion

Batch

26547RT 09-04-21

2.0	SKIDTUBES L	SKIDTUBESS RESOURCE 1
-----	-------------	-----------------------

**Comment:** LANDING GEAR RESOURCE 1

Cut extrusion to 46.52 +0.010 -0.020

RT 09-04-21

3.0	BENDING	BENDING MACHINE - SKIDTUBES
-----	---------	-----------------------------

**Comment:** Nc bender

Bend as per Dwg D3391 Using Bend Prog 3391021

RT 09-04-21

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 20/04/2009 1:54:33 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FWD TUBE ASSEMBLY

Job Number: 47306

Part Number: D3391021

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

4.0	QC5	INSPECT WORK TO CURRENT STEP
-----	-----	------------------------------



$h = 7.100"$
 $L = 13.5"$



Comment: INSPECT WORK TO CURRENT STEP

SA 09/04/26

5.0	HAAS1	HAAS CNC VERTICAL MACHINING #1
-----	-------	--------------------------------



Comment: HAAS CNC VERTICAL MACHINING #1

1-Machine as per Folio FA590 Rev. F & Dwg D3391 Rev. H

Identify as D3391-1

2-Deburr

N.A 09/04/26

6.0	QC2	INSPECT PARTS AS THEY COME OFF MACHINE
-----	-----	--



Comment: INSPECT PARTS AS THEY COME OFF MACHINE

N.A 09/04/26

7.0	MILLING CONV.	CONVENTIONAL MILLING MACHINE
-----	---------------	------------------------------



Comment: CONVENTIONAL MILLING MACHINE

Drill X1 Aft cap as per Dwg D3391 .1875" dia

SA 09/04/27

8.0	QC2	INSPECT PARTS AS THEY COME OFF MACHINE
-----	-----	--



Comment: INSPECT PARTS AS THEY COME OFF MACHINE

SA 09/04/27

9.0	QC8	SECOND CHECK
-----	-----	--------------



Comment: SECOND CHECK

SA 09/04/28 (1)

10.0	SKIDTUBES 1	SKIDTUBESS RESOURCE 1
------	-------------	-----------------------



Comment: LANDING GEAR RESOURCE 1

1-Drill float bag holes as per Dwg D3391 using DT8798(Do not open tow cap holes to finish size)
(ONLY DRILL HOLES MARKED "A")

2-Drill Remaining two holes for tow cap using DT 8819 Locating off of .1875" holes drilled in previous step

3-Open tow cap holes to .208" as per Dwg D3391

4-Open Tow Ring hole to .640" as per Dwg D3391

5- open float bag holes 0.328" and counter sink as per dwg D3391

Y1
9-4-28

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 20/04/2009 1:54:33 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FWD TUBE ASSEMBLY

Job Number: 47306

Part Number: D3391021

Job Number:



Seq. #:

Machine Or Operation:

Description :

6-Deburr & Scribe Batch number Inside aft end.

7-Transfer drill D3391-021 with D3391-023

) M 9-4-28

11.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

S 09/04/09 (X)

12.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



A4M 9-4-30



①

Comment: HAND FINISHING RESOURCE #1

Acid etch and Alodine as per QSI 005 4.1

13.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

D M 9-4-30

14.0

D36704200

SPACER



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

SPACER

batch: 64606

M 9-4-30

15.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-instal spacers as per dwg D3391

A/R Magnabond 6398 batch: M111299

exp. date: 12-2-1

cure time 12hrs. as per QSI015

2- grind crossbolt flush

3-back drill crossbolt if necessary

M 9-4-30

M 9-4-23 9-5-4

16.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

S 09/05/04 (X)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 20/04/2009 1:54:34 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FWD TUBE ASSEMBLY

Job Number: 47306

Part Number: D3391021

Job Number:



Seq. #: Machine Or Operation: Description :

17.0 POWDER COATING POWDER COATING



m109996



(PD) →

Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

START TIME: 12:40

OVEN TEMPERATURE: 320°

FINISH TIME: 1:10

FD 09/05/04

(1)

18.0 QC3 INSPECT POWDER COAT/CHEMICAL CONVERSION



(2)

Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

DR 09-05-5

19.0 D3401041 Tow Cap Assembly



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)
Tow Cap Assembly

B41931

MD 09/07/06

20.0 D356413 Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)
Wearshoe

B47807

UMD 09/07/06

21.0 D356613 Gasket



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)
Gasket

B46889

UMD 09/07/06

22.0 D36721 Phenolic Washer



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)
Phenolic Washer

B42309

UMD 09/07/06

23.0 AN3C4A BOLT



Comment: Qty.: 10.0000 Each(s)/Unit Total: 10.0000 Each(s)
BOLT

m112082

UMD 09/07/06

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: D3391-021 PAR #: N/A Fault Category: Skid tubes NCR: Yes No DQA: 1 Date: 09.07.16
 Resolution: re-work Disposition: re-work QA: N/C Closed: 1 Date: 09.08.17

NCR: 47306		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
9/7/16	#17	Found one wear plate hole not opened to finish size QC missed at inspection		Drill hole to correct size and deburr	# 97-6	S 09/07/16	10/07/16	S 09/07/16
			10/07/16	Touch up hole w/Alodine and white Emron paint	MD 09/07/16			
		cap fabrication	10/07/16	As per QST 005	MD 09/07/16	S 09/07/16	10/07/16	G 09/07/16

NOTE: Date & initial all entries

Date: Monday, 20/04/2009 1:54:34 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FWD TUBE ASSEMBLY

Job Number: 47306

Part Number: D3391021

Job Number:



Seq. #:

Machine Or Operation:

Description :

24.0

AN960C10L

washer



*** Comment: Qty.: 10.0000 Each(s)/Unit Total : 10.0000 Each(s)

washer

m112116

mo 09/07/06

25.0

ALS41032130

Insert



*** Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

INSERT

m110511

mo 09/07/06

26.0

ALS41032225

Insert



*** Comment: Qty.: 10.0000 Each(s)/Unit Total : 10.0000 Each(s)

INSERT

m110768

mo 09/07/06

27.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and Stock

Location: _____

28.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: SKIDTUBESS RESOURCE 1

**** install D3591-1 spacer as per DS19364 ****

BR 09-07-8

29.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

Job Completion




W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector
09/07/07	20.1	install insert and tow cap as per Dwg 3391-001	MD BLC	09-07-07	①		

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

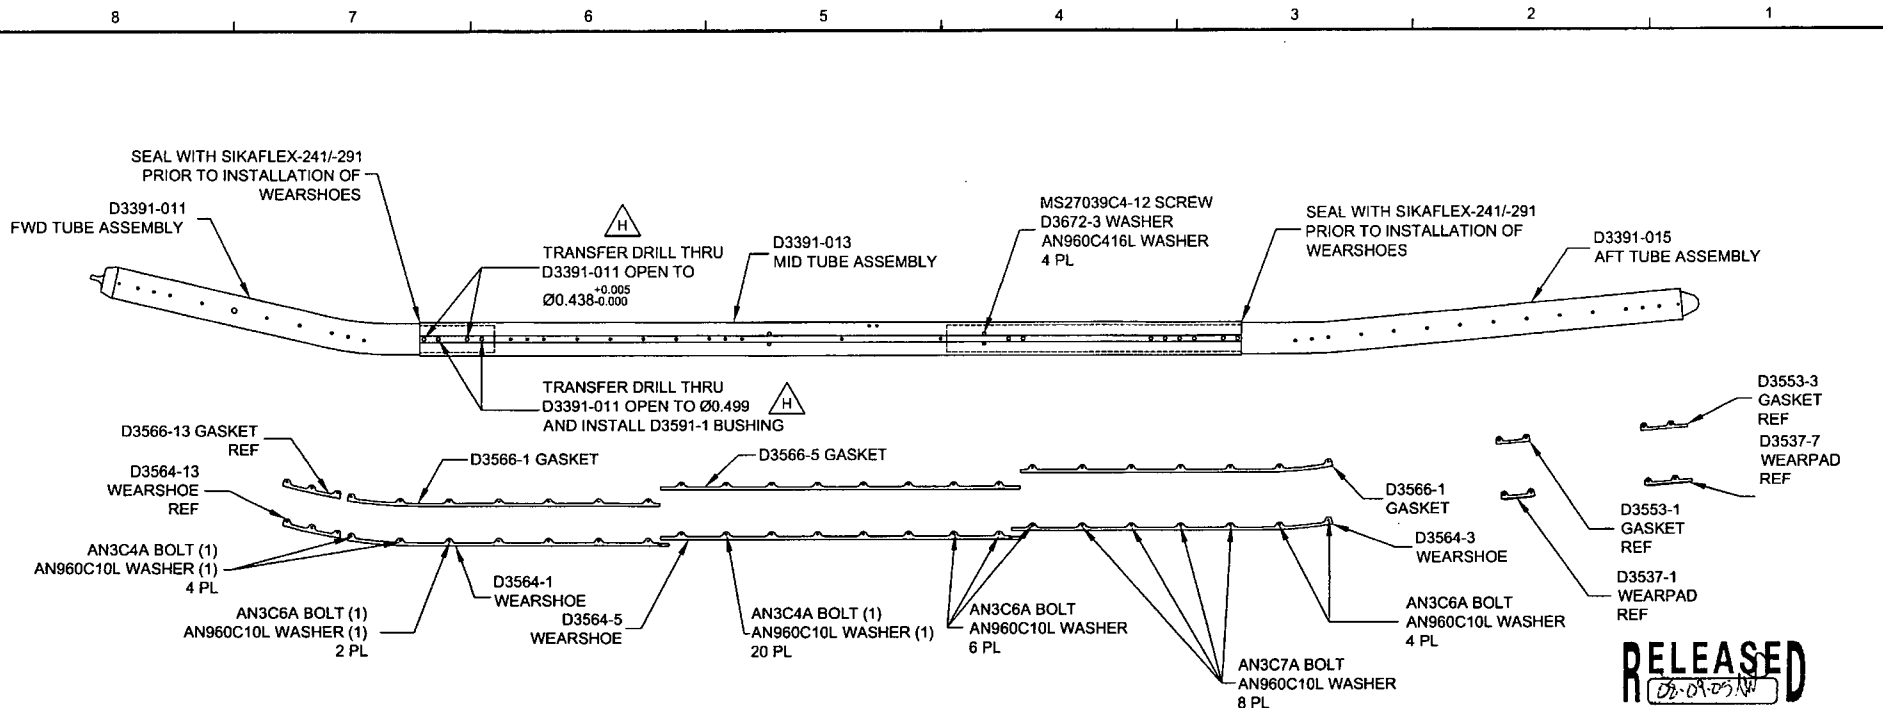



D3391-041 ASSEMBLY

D3391-041 FLOAT SKIDTUBE ASSEMBLY PARTS LIST


QTY	PART NUMBER	DESCRIPTION
X	D3391-041	FLOAT SKIDTUBE ASSEMBLY
1	D3391-011	FWD TUBE ASSEMBLY
1	D3391-013	MID TUBE ASSEMBLY
1	D3391-015	AFT TUBE ASSEMBLY
1	D3564-1	WEARSHOE
1	D3564-3	WEARSHOE
1	D3564-5	WEARSHOE
2	D3566-1	GASKET
1	D3566-5	GASKET
2	D3591-1	BUSHING
4	D3672-3	WASHER
24	AN3C4A	BOLT
12	AN3C6A	BOLT
8	AN3C7A	BOLT
44	AN960C10L	WASHER
4	MS27039C4-12	SCREW
4	AN960C416L	WASHER

GENERAL NOTES

  - 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1 POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES FOR WEARSHOE INSERTS. CBORE AS NOTED AND INSTALL INSERTS EXCEPT WHERE INDICATED.

H	DRAWING UPDATED TO CURRENT STANDARDS. SHT 1 PL ADDED D3591-1 BUSHING. ZN C6 Ø0.438 DIM WAS 4 PL. ADDED Ø0.499 DIM AND D3591-1 BUSHING. SHT 2 PL ADDED D3591-1 BUSHING. ZN C6 Ø0.438 DIM WAS 4 PL. ADDED Ø0.499 DIM AND D3591-1 BUSHING. (FOR FURTHER INFO SEE DSI 9364 & NCR 08-074)	AJS	08.08.20
G	REPLACE NAS INSERTS W/ AELS INSERTS SWITCH TO D3670-XXXX SPACERS FOR INSTALLING FLOAT BAGS, DWG REORGANIZED FOR CLARITY	DC	07.07.31
F	ADD SS WEARSHOE, GASKET REMOVE FWD SADDLE HOLE -011/-021	PH	07.01.18
E	CHANGE TOLERANCE, EASE MANUFACTURE	PH	06.04.25
D	UPDATE TOLERANCE, CHANGE HOLE SIZE	PH	06.01.23
C	LENGTHEN AFT EXTENSION	PH	05.09.27
B	DRAWING UPDATES	PH	05.06.10
A	NEW ISSUE	PH	05.02.07
REV.	DESCRIPTION	BY	DATE
DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 1 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY MANNER WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

NO. 217306
 WORK ORDER
 WITH DUT NOTICE
 UNCONTROLLED COPY
 RETURN TO
 ENGINEERING
 SHOP COPY

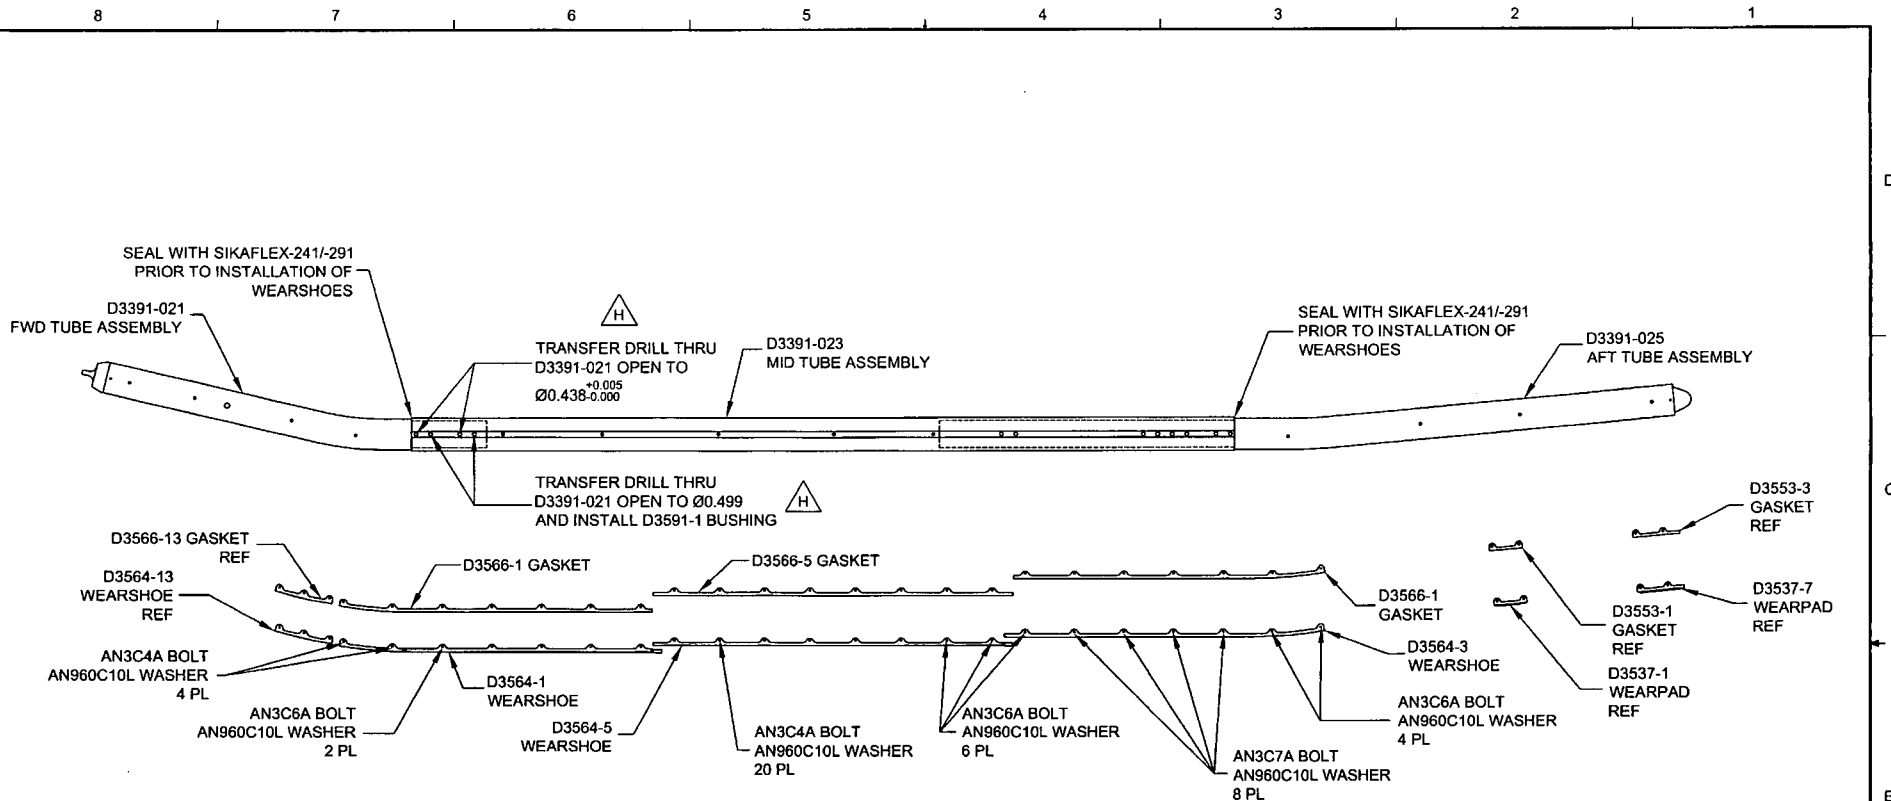

D3391-043 ASSEMBLY




D3391-043 FLOAT SKIDTUBE ASSEMBLY PARTS LIST

QTY	PART NUMBER	DESCRIPTION
1	D3391-043	FLOAT SKIDTUBE ASSEMBLY
1	D3391-021	FWD TUBE ASSEMBLY
1	D3391-023	MID TUBE ASSEMBLY
1	D3391-025	AFT TUBE ASSEMBLY
1	D3564-1	WEARSHOE
1	D3564-3	WEARSHOE
1	D3564-5	WEARSHOE
2	D3566-1	GASKET
1	D3566-5	GASKET
2	D3581-1	BUSHING
24	AN3C4A	BOLT
12	AN3C6A	BOLT
8	AN3C7A	BOLT
44	AN960C10L	WASHER


GENERAL NOTES

- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY. CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES FOR WEARSHOE INSERTS. C'BORE AS NOTED AND INSTALL INSERTS EXCEPT WHERE INDICATED.


RELEASED
08-09-25/14

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 2 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			


SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 279309

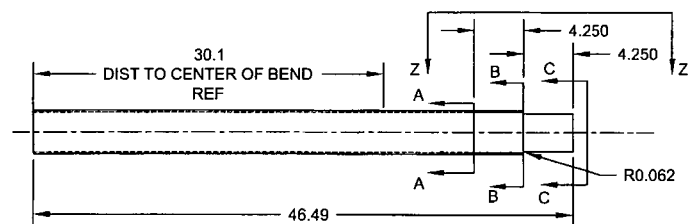


D3391-1 CUTTING DETAIL
(MAKE FROM D6013-047 SKIDTUBE MATERIAL)

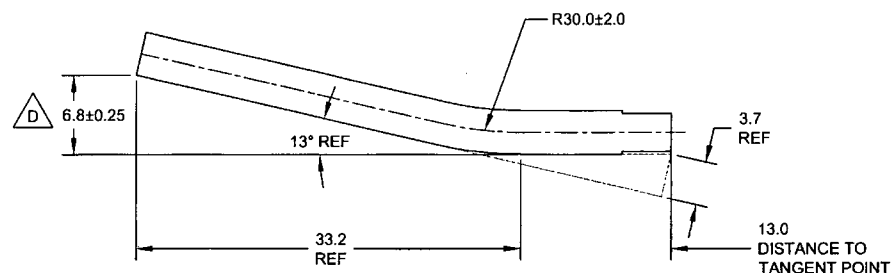


D3391-011/-021 BENDING DETAIL
(MAKE FROM D3391-1)

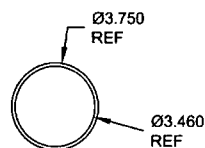


SECTION A-A
SCALE 2X

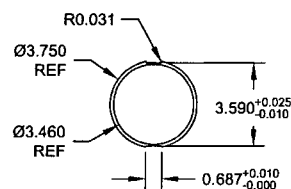

SECTION B-B
SCALE 2X

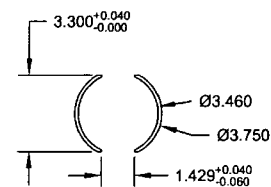

SECTION C-C
SCALE 2X

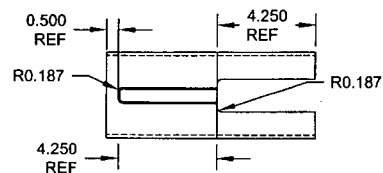


VIEW Z-Z
SCALE 2X






RELEASED
08-05-11

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AUS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 3 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	<small>COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 4738

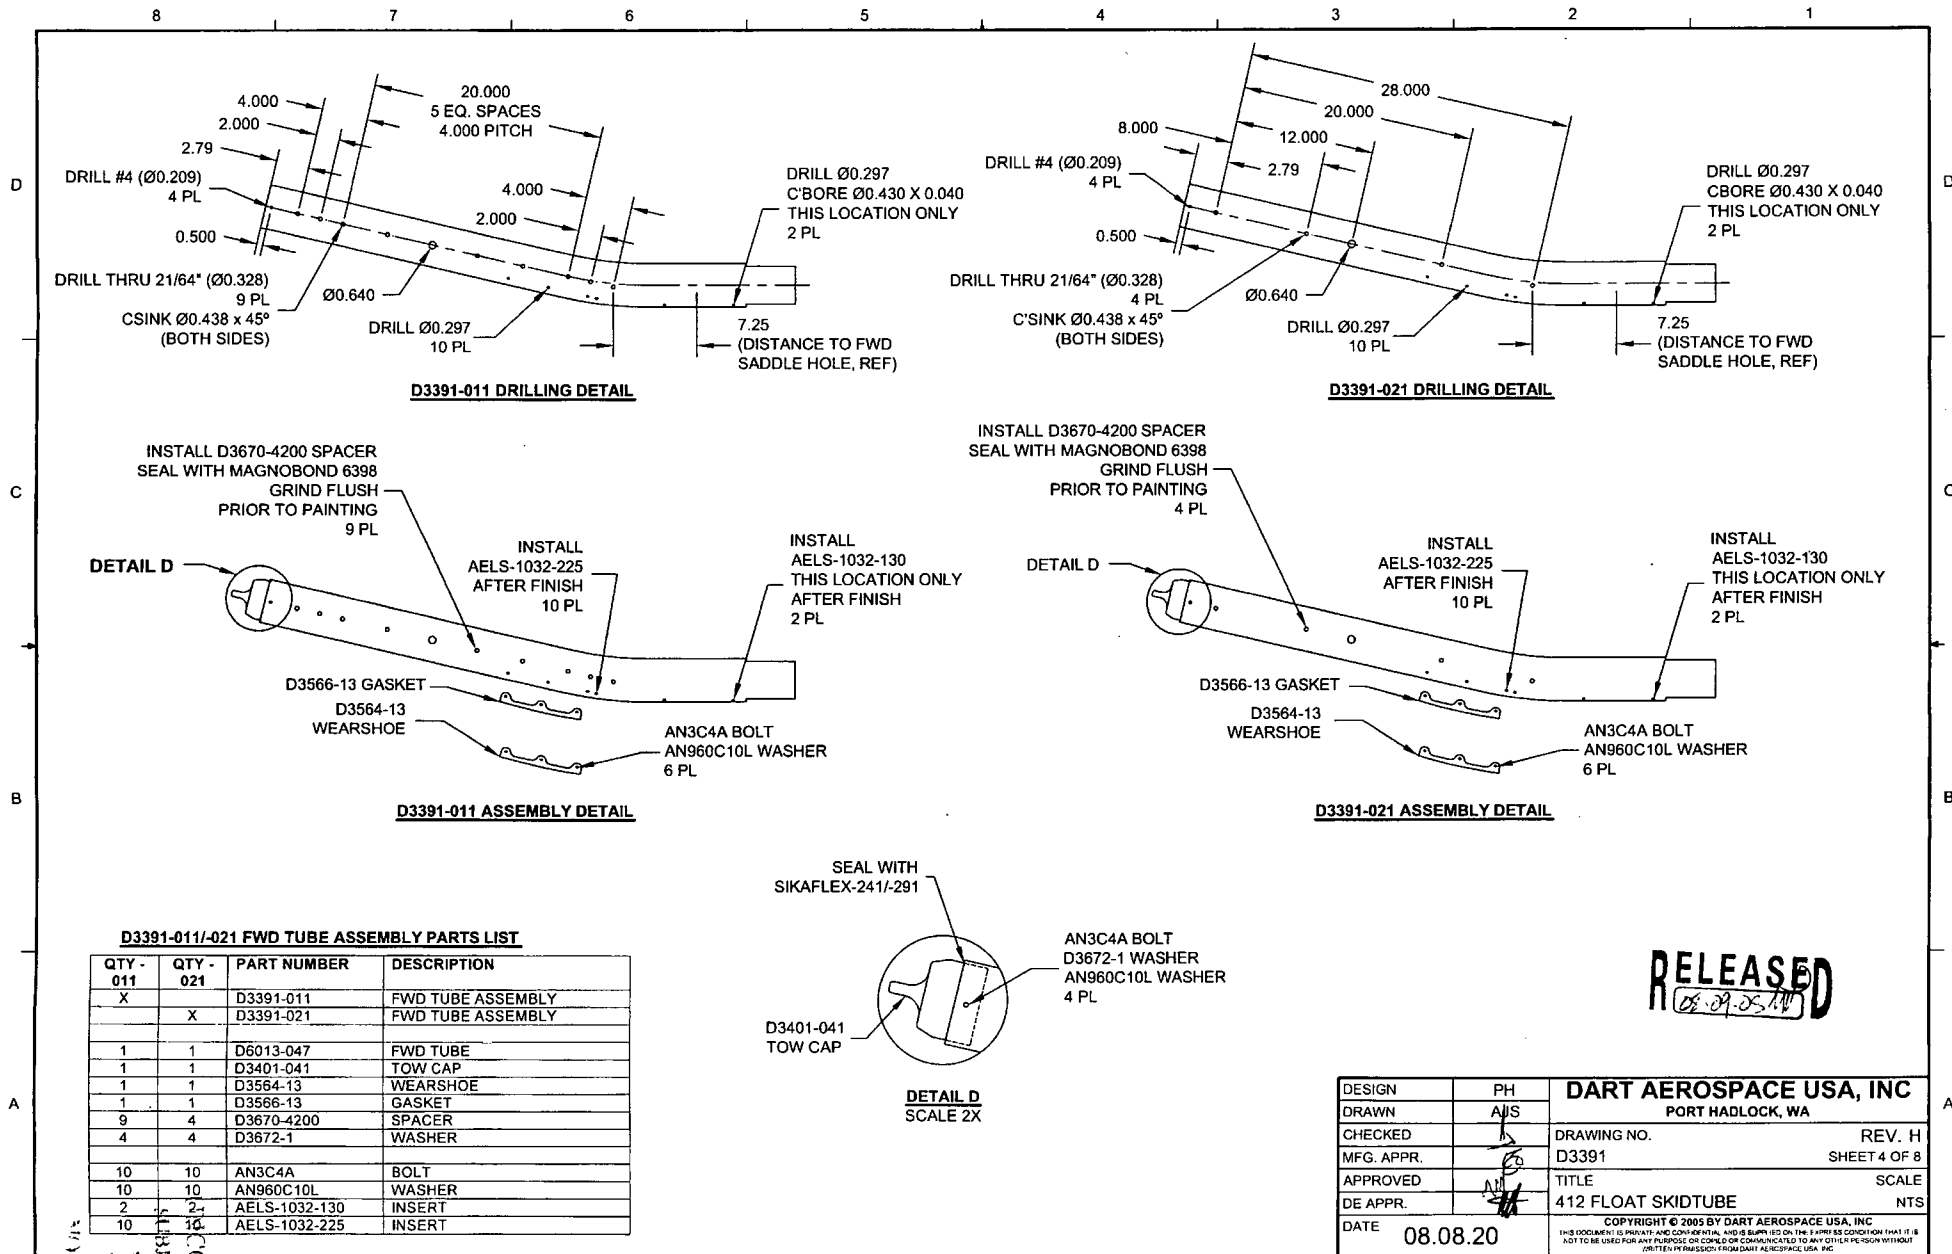

SHOP COPY
RETURN TO
ENGINEERING
CONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
47304

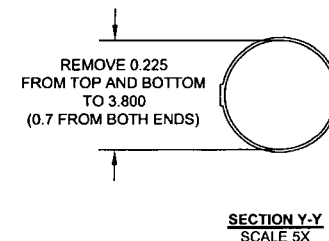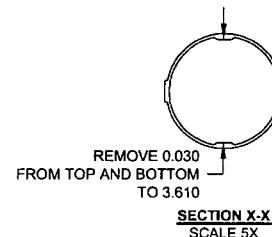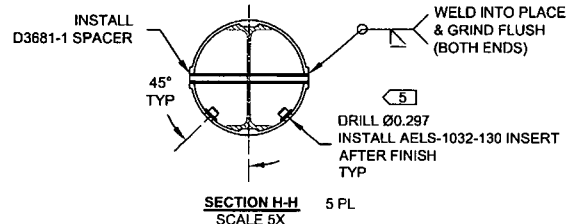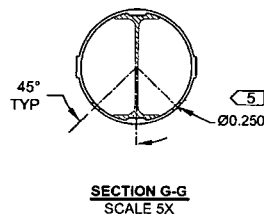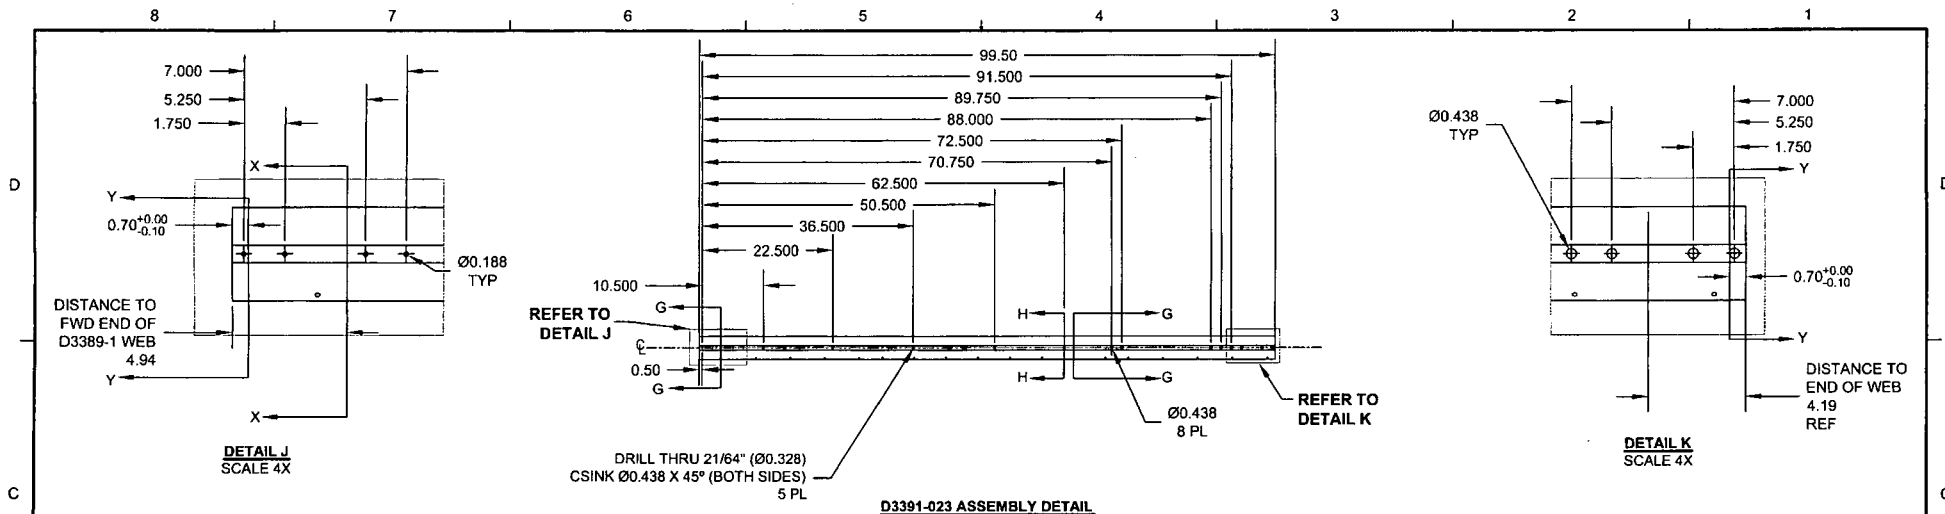

D3391-023 MID TUBE ASSEMBLY PARTS LIST





QTY - 023	PART NUMBER	DESCRIPTION
X	D3391-023	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
5	D3681-1	SPACER
20	AELS-1032-130	INSERT


D3391-023 MID TUBE ASSEMBLY

- 1) MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
- 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/-291 PER QSI 015
- 3) WELDING: PER DART QSI 004



STOP COPY
RETURN TO
ENGINEERING
CONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 130

RELEASED
08-05-17

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 6 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COME OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

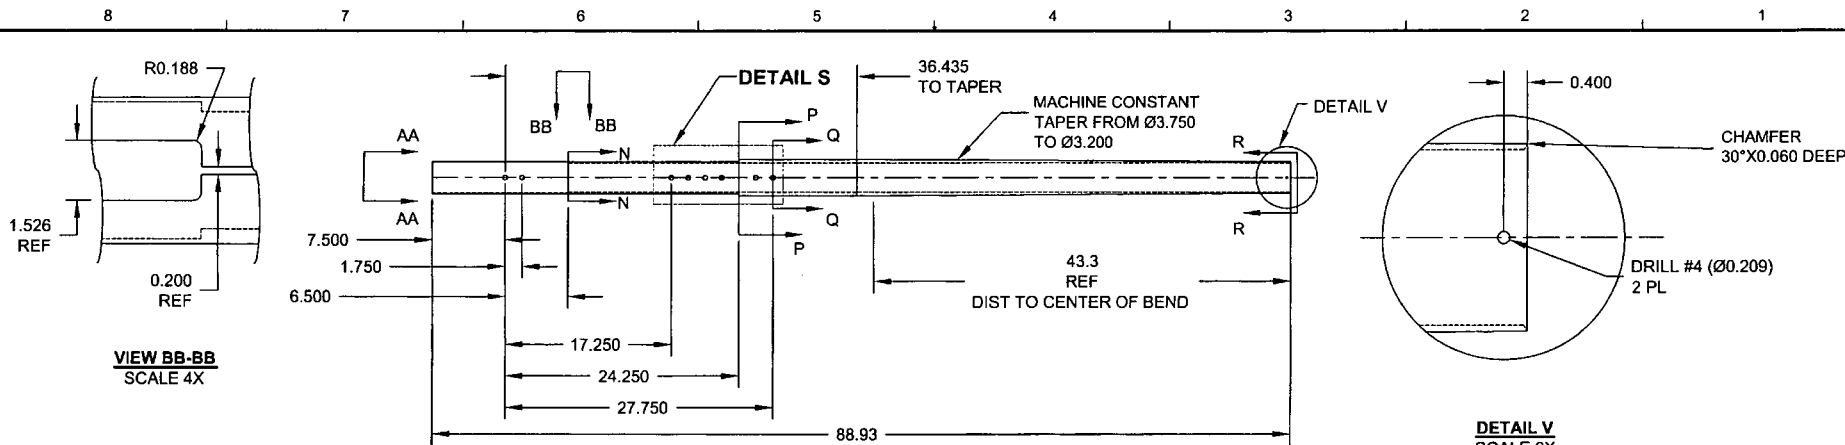


D3391-3 AFT DRILLING AND CUTTING DETAIL
(MAKE FROM D6014-090 SKIDTUBE MATERIAL)

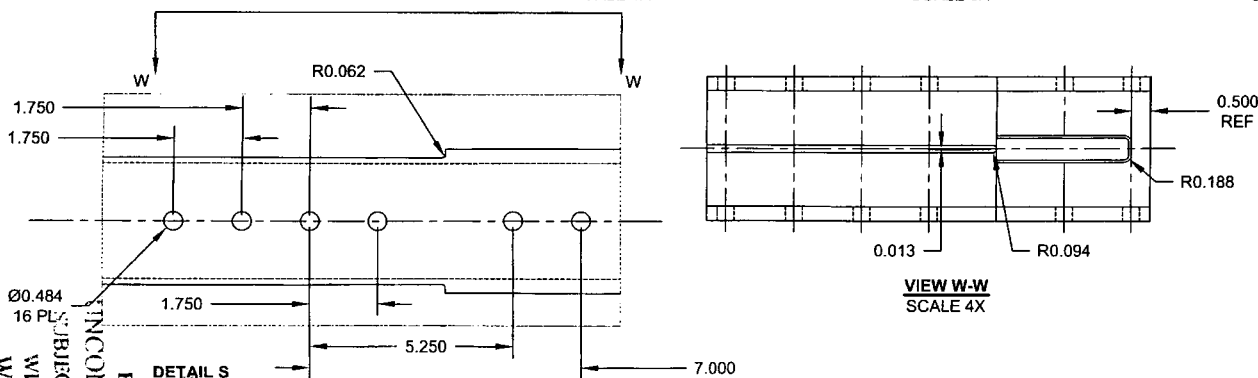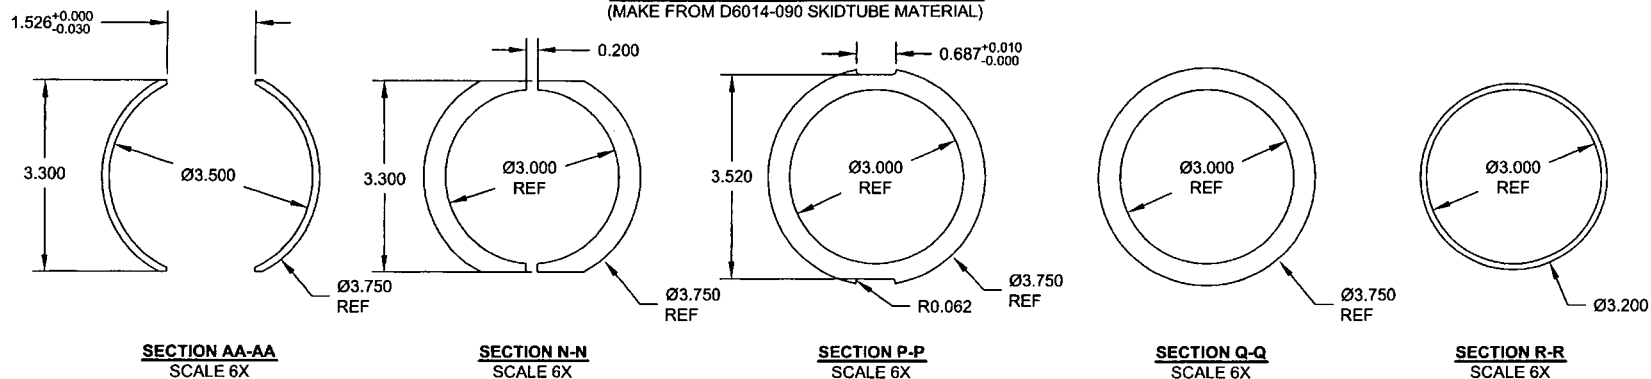

RELEASED
27 JUN 78


DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 7 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	<small>COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

TOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
147308

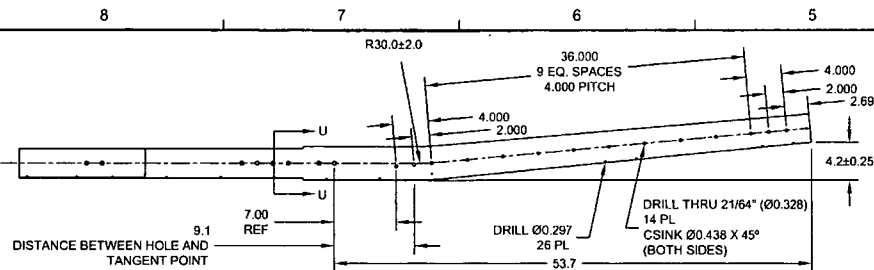

D3391-015 BENDING AND DRILLING DETAIL
(SEE CBORE DETAIL BELOW)

INSTALL D3670-4200 SPACER
SEAL WITH MAGNOBOND 6398
GRIND FLUSH
PRIOR TO PAINTING
14 PL

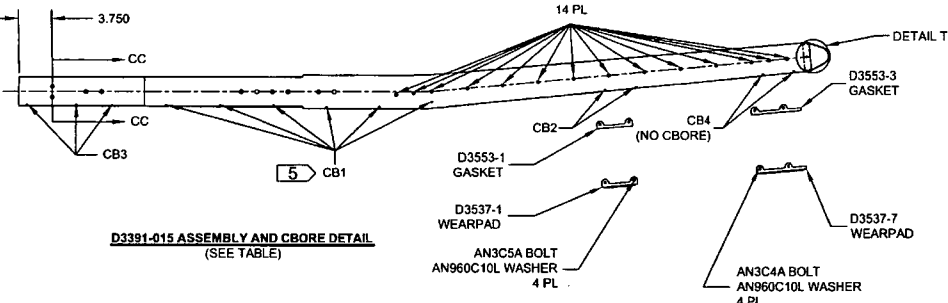


D3391-015 ASSEMBLY AND CBORE DETAIL
(SEE TABLE)

D3391-015/-025 AFT TUBE ASSEMBLY PARTS LIST


QTY - 015	QTY - 025	PART NUMBER	DESCRIPTION
X	X	D3391-015	AFT TUBE ASSEMBLY
X	X	D3391-025	AFT TUBE ASSEMBLY
1	1	D6014-090	AFT TUBE
1	1	D2646	AFT CAP
1	1	D3537-1	WEARPAD
1	1	D3537-7	WEARPAD
1	1	D3553-1	GASKET
1	1	D3553-3	GASKET
14	4	D3670-4200	SPACER
2	2	D3672-1	WASHER
14	14	AELS-1032-130	INSERT
12	12	AELS-1032-225	INSERT
4	4	ALS4-428-165	INSERT
6	6	AN3C4A	BOLT
4	4	AN3C5A	BOLT
10	10	AN960C10L	WASHER

CBORE HOLES MARKED CB1-CB4 AS FOLLOWS AND
INSTALL AELS-1032-XXX AFTER FINISH AS NOTED

HOLES MARKED	QTY D3391-015	QTY D3391-025	CBORE	P/N
CB1	12	12	Ø0.430 X 0.170	AELS-1032-225
CB2	4	4	Ø0.430 X 0.170	AELS-1032-130
CB3	6	6	Ø0.430 X 0.040	AELS-1032-130
CB4	4	4	NONE	AELS-1032-130

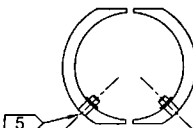


SECTION U-U
SCALE 3X

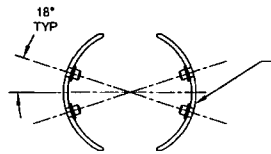


SECTION CC-CC
SCALE 3X

DRILL Ø0.391
CBORE Ø0.616 X 0.040 DEEP
INSTALL ALS4-428-165 INSERT
4 PL

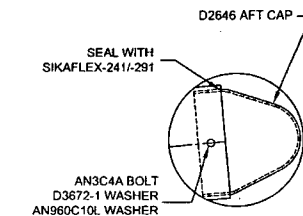

DETAIL T
SCALE 4X

RELEASED
08-09-05 11:10

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 8 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC <small>THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

NO. 47306
WORK ORDER
SUBJECT TO AMENDMENT
WITHOUT NOTICE
SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY